


CUSTOMER TERMINAL	ROHS	Lead (Pb) -free
	YES	YES



A PASSION
FOR TECHNOLOGY

1.Mechanical Dimensions

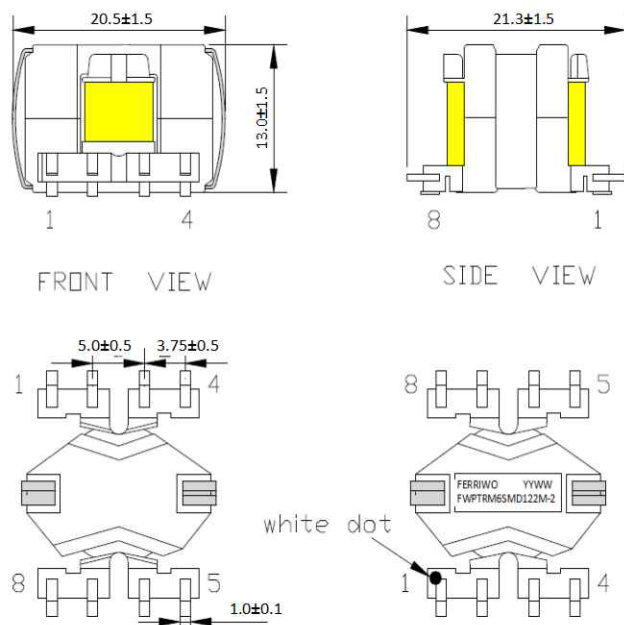

3.Material List

Core:FW40-RM6


Bobbin:FWB0632-P

Wire:2UEW-0.20/0.32mm 130℃

Tape:WF-2901-1.0mm CT-280-25u-6.5mm

Operating Temperature: -30 to 115℃

2.Schematic Diagram

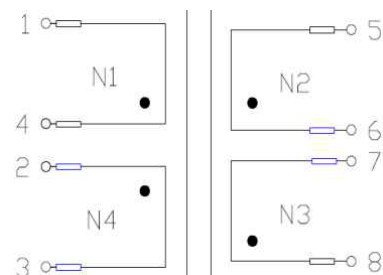

4.Electrical Specification

Inductance: $L(4-1)=1.2\text{mH}\pm 20\%$ 1.0KHZ 1.0V

DCR: $(4-1)=1.0\Omega$ MAX.

Hi-pot: N1-N2,N3 AC 3000V 5mA 10S

N1-N4 AC 2500V 5mA 10S

N2,N3-N4 AC 1500V 5mA 10S

REV.	DATE	Convention Placement	DRW.		Drawing Title: TRANSFORMER Customer P/N:	Part No:
0	00/00		CHK.			FWPTRM6SMD122M-2
			APP.			Specification Sheet 1 of 1

RoHS

www.fosopower.com

THIS DOCUMENT IS STRICTLY NOT ALLOWED TO BE DUPLICATED WITHOUT AUTHORIZATION